

Inspection Date	Pipe ID	Size	Material	Length	Problems	Solution	Reasons
	EP- 1809	18"	RCP				Halfline could not be inspected. Needs to be cleaned and inspected.
1/26/2020 - 1/27/2020	EP- 2401.2	18"	RCP	97.7	Yes	Clean and Line	<ul style="list-style-type: none"> Potentially could be replaced due to major chips/broken areas at joints Major chips, Major transverse cracking (> 12"), broken areas within the pipe, all other issues are with joint offsets and gaskets
1/8/2020	Y18.1	18"	RCP	122.3	Yes	Replace	<ul style="list-style-type: none"> Major chips, Major transverse cracking (> 12"), broken areas within the pipe, all other issues are with joint offsets and gaskets
1/26/2020 - 1/27/2020	EP- 2401	24"	RCP	88	Yes	Clean and Line	<ul style="list-style-type: none"> Potentially could be replaced due to major chips/broken areas at joints Major chips, Major transverse cracking (> 12"), broken areas within the pipe, all other issues are with joint offsets and gaskets
1/16/2020	EP- 3002	30"	RCP	85.9	Yes	Clean and Line	<ul style="list-style-type: none"> Major transverse cracking (> 12"), all other issues are with joint offsets and gaskets
1/16/2020	EP- 3600	36"	RCP	98.1	Yes	Clean and Line	<ul style="list-style-type: none"> Major transverse cracking (>12"), chips in joints
1/26/2020 - 1/27/2020	EP- 3601	36"	RCP	96.1	Yes	Clean and Line	<ul style="list-style-type: none"> Major transverse cracking (> 12"), all other issues are with joint offsets
1/16/2020	EP- 3602	36"	RCP	58.1	Yes	Clean and Line	<ul style="list-style-type: none"> Potentially could be replaced due to major chips at joints Major cracking (> 12"), major chips, all other issues are with joint offsets
1/8/2020	EP- 42.1	42"	RCP	290.8	Yes	Clean and Line	<ul style="list-style-type: none"> Major cracking (> 12"), minor exposed rebar, all other issues are with joint offsets and gaskets
1/16/2020	EP- 6001	60"	RCP	40	Yes	Clean and Line	<ul style="list-style-type: none"> Major transverse cracking (> 12")
1/16/2020	EP- 6002	60"	RCP	44.1	Yes	Clean and Line	<ul style="list-style-type: none"> Minor chips in the pipe, all other issues are with joint offsets
1/16/2020	EP- 6003	60"	RCP	17	Yes	Clean and Line	<ul style="list-style-type: none"> Surface Damage
1/16/2020	EP- 6004	60"	RCP	12	No	Clean and Line	<ul style="list-style-type: none"> Minor transverse cracking (< 12"), all other issues are with joint offsets
1/16/2020	EP- 4811	72"	RCP	85	Yes	Clean and Line	<ul style="list-style-type: none"> Major transverse cracking (> 12"), all other issues are with joint offsets and gaskets
1/9/2020	EP- 8401	84"	RCP	165	Yes	Clean and Line	<ul style="list-style-type: none"> Pipe Report missing. In video, most joints have been grouted on the bottom half. @ 72' there is Infiltration on both sides of the pipe at the joint. Pipe lift points for each segment have not been grouted.
1/9/2020	EP- 8402	84"	RCP	160	Yes	Clean and Line	<ul style="list-style-type: none"> Pipe report missing. In video, most joints have been grouted on the bottom half. @ 152' there is infiltration on both sides of the pipe at the joint. Pipe lift points for each segment have not been grouted. Debris in pipe.
	EP- 1831	18"	RCP	N/A	Yes	Clean and Reinspect	Pipe could not be inspected due to debris inside the pipe
	EP- 3601 End	36"	RCP	N/A	Yes	Clean and Reinspect	Pipe could not be inspected due to debris inside the pipe
	EP- 4801	48"	RCP	N/A	Yes	Clean and Reinspect	Pipe could not be inspected due to debris inside the pipe
	ECMP- 4800	48"	CMP	N/A	Yes	Clean and Reinspect	Pipe could not be inspected due to debris inside the pipe
1/16/2020	EP- 3603	36"	RCP	36.4	Yes	Retain	<ul style="list-style-type: none"> No major issues in pipe